
# State of Utah DEPARTMENT OF NATURAL RESOURCES DIVISION OF OIL, GAS AND MINING

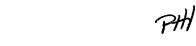

**INSPECTION REPORT** 

Michael O. Leavitt Governor

Lowell P. Braxton Division Director 1594 West North Temple, Suite 1210 PO Box 145801 Salt Lake City, Utah 84114-5801

801-538-5340 801-359-3940 (Fax) 801-538-7223 (TDD) Partial: XXX | Complete: Exploration: Inspection Date & Time: 9/9/99 / 10:00a.m.-12:00p.m.

Date of Last Inspection: 8/4/99

Mine Name: Wildcat Loadout County: Carbon Permit Number: ACT/007/033 *						
Permittee and/or Operator's Name: Andalex Resources, Inc.						
Business Address: P. O. Box 902, Price, Utah 84501						
Type of Mining Activity: Underground Surface Prep. Plant XXX Other						
Company Official(s): John Pappas						
State Officials(s): Stephen J. Demczak Federal Official(s): None						
Weather Conditions: Clear, 70's						
Existing Acreage: Permitted-100 Disturbed-63.7 Regraded- Seeded- Bonded-63.7						
Increased/Decreased: Permitted Disturbed Regraded Seeded Bonded						
Status: _Exploration/_XXX_Active/Inactive/Temporary Cessation/Bond Forfeiture						
Reclamation (_Phase I/_Phase II/_Final Bond Release/_LiabilityYear)						

# REVIEW OF PERMIT, PERFORMANCE STANDARDS & PERMIT CONDITION REQUIREMENTS

#### Instructions

- 1. Substantiate the elements on this inspection by checking the appropriate performance standard.
  - a. For <u>complete inspections</u> provide narrative justification for any elements not fully inspected unless element is not appropriate to the site, in which case check N/A.
  - b. For <u>partial inspections</u> check only the elements evaluated.
- 2. Document any noncompliance situation by referencing the NOV issued at the appropriate performance standard listed below.
- 3. Reference any narratives written in conjunction with this inspection at the appropriate performance standard listed below.
- 4. Provide a brief status report for all pending enforcement actions, permit conditions, Division Orders, and amendments.

1.	PERMITS, CHANGE, TRANSFER, RENEWAL, SALE	EVALUATED [XX]	<u>N/A</u>	COMMENTS [XX]	NOV/ENF
2.	SIGNS AND MARKERS	[XX]	H	XXI	Ħ
3.	TOPSOIL	[XX]	Ħ	[XX]	Ħ
4.	HYDROLOGIC BALANCE:		-		-
a.	DIVERSIONS	[XX]	[ ]	[XX]	[]
b.	SEDIMENT PONDS AND IMPOUNDMENTS	XX		$\overline{[XX]}$	Π
c.	OTHER SEDIMENT CONTROL MEASURES	XX	$\overline{\Box}$	$\overline{[XX]}$	$\Box$
d.	WATER MONITORING		Π		口
e.	EFFLUENT LIMITATIONS		$\Box$		$\Box$
5.	EXPLOSIVES	XX	$\Box$	$\overline{XX}$	Π
6.	DISPOSAL OF EXCESS SPOIL/FILLS/BENCHES	Ц	Π	П	Ī
7.	COAL MINE WASTE/REFUSE PILES/IMPOUNDMENTS	[XX]	П	[XX]	$\Box$
8.	NONCOAL WASTE	[XX]	ĹĪ	[XX]	ĹĬ
9.	PROTECTION OF FISH, WILDLIFE AND				
	RELATED ENVIRONMENTAL VALUES	$\Box$	$\Box$	$\Box$	$\Box$
10.	SLIDES AND OTHER DAMAGE	Π	$\Box$	$\Box$	$\Box$
11.	CONTEMPORANEOUS RECLAMATION		Ц	П	ĹÌ
12.	BACKFILLING AND GRADING	ĹĬ	ĹĬ	ĹĴ	Ĺĺ
13.	REVEGETATION	$\Box$	П	$\Box$	ĹĬ
14.	SUBSIDENCE CONTROL	$\Box$	$\Box$		$\Box$
15.	CESSATION OF OPERATIONS	$\Box$	$\Box$	$\Box$	$\Box$
16.	ROADS:				
a.	CONSTRUCTION/MAINTENANCE/SURFACING	$\Box$	$\Box$	$\Box$	$\Box$
b.	DRAINAGE CONTROLS	ĹĬ	Ĺĺ	ĹĬ	Ĺ
17.	OTHER TRANSPORTATION FACILITIES	ĹĬ	$\Box$	Ĺĺ	$\Box$
18.	SUPPORT FACILITIES/UTILITY INSTALLATIONS	[XX]	$\Box$	$\overline{[XX]}$	$\Box$
19.	AVS CHECK (4th Quarter-April, May, June) (date)	П		ШĪ	Ĺĺ
20.	AIR QUALITY PERMIT	Π	ĹĬ	Ĺ	Π
21.	BONDING & INSURANCE	ĹĬ	Ш	$\Box$	$\Box$

# INSPECTION REPORT

(Continuation sheet)

Page <u>2</u> of <u>2</u>

PERMIT NUMBER: ACT/007/033

DATE OF INSPECTION: 9/9/99

(Comments are Numbered to Correspond with Topics Listed Above)

#### 1. PERMIT-

There are no major or minor amendments being reviewed nor have any been received by the Division as per tracking sheet.

#### 2. SIGNS AND MARKERS -

Identification signs meet the requirements of the R645 Coal Rules. The perimeter markers were spot-checked and are located around the perimeter of the disturbed area. Wildcat Loadout is not near a stream; therefore, has no stream buffer zones. All topsoil piles have signs for identification.

# 3. TOPSOIL -

The topsoil piles were inspected with no signs of wind or water erosion. These piles are protected by berms.

#### 4A. DIVERSIONS -

The diversions were spot-checked and several ditches will need to be cleaned out in the near future. This sediment build-up was caused by the recent rain storms. The diversion ditch is not a violation at this time.

#### 4B. SEDIMENT PONDS -

The sediment ponds were not discharging during the inspection and will not likely discharge in the near future. These ponds did contain a little or no water. There were no signs of any hazardous conditions occurring to the sediment ponds during the inspection.

#### 4C. OTHER SEDIMENT CONTROL MEASURES -

The Wildcat Loadout facility uses straw bales as its alternate sediment control measures. These areas were spot-inspected and complied with the R645 Coal Rules.

#### 5. EXPLOSIVES -

There are no explosive's boxes on the property.

# 7. REFUSE PILES -

Refuse pile was inspected with no hazardous conditions being noticed.

# 8. NON-COAL WASTE -

The area was clear of non-coal waste material.

# 18. SUPPORT FACILITIES -

There were no additional support facilities noticed.

Note: This inspection report does not constitute an affidavit of compliance with the regulatory program of the Division of Oil, Gas, and Mining.

Copy of this Report:

Mailed to: Mike Glasson (Andalex)
Given to: Joe Helfrich (DOGM)

Henry Austin (OSM)

Filed to: Price Field Office

Date: September 9, 1999

Inspector's Signature:

Stank of L. Dam and

#39